

# Evaluation of Adequacy Fishery Port Infrastructure (Case Study on Fishery Port Mimbo Situbondo)

*by* Noor Salim

---

**Submission date:** 04-Sep-2018 09:45AM (UTC+0700)

**Submission ID:** 996528581

**File name:** Pak\_Noor\_Salim.pdf (592.65K)

**Word count:** 5087

**Character count:** 23505

## Evaluation of Adequacy Fishery Port Infrastructure (Case Study on Fishery Port Mimbo Situbondo)

Noor Salim

Faculty of Technic, Muhammadiyah University of Jember

**Abstract:** Fishery Port City Beach is located in the district of Situbondo Banyu Putih which is approximately 50 km from the city center. Exact location of the fishery port in the district directly adjacent to the Banyu Putih Banyuwangi industrial plant which contained fish canning factory in the district Muncar. In development, this port functions not only as a fishery port but also, as the crossing place to the Sepudi island which is included of Madura district. Different from the original plan, transportation within the port has changed. Reserved parking area no longer function optimally. So that needs to be addressed and the need for further study are: to analyze the adequacy of the pier and parking lot, and to evaluate the adequacy of the road in the hinterland. From the results, we get few things: The need for the loading dock and mooring for a boat the size of the existing less or more than 10 GT still be fulfilled properly. Unloading dock for ship size is less or more than 10 GT still be met but overload jetty mooring for vessels up to 254% for vessel with size of more than 10 GT and 128% for vessels less than 10 GT size. By changing the way the mooring of vessels dilated / transverse require less space, so the ship mooring space requirements can be fulfilled until 2016. The adequacy of existing parking space is available for cars and trucks only and can provide for parking requirement. The number of vehicles entering the port increased so that parking spaces be overloaded so it is need to provide parking spaces for motorcycles and pick-up. By utilizing the tip of the breakwater area for motorcycle parking space (688 m<sup>2</sup>) with a pattern of two sides and the base of the breakwater area for car parking (650m<sup>2</sup>) with a pattern of one side and a parking area that has been available previously for the truck and pick-up, parking space requirements can be fulfilled. Adequacy Road at Hinterland area with increasing number of vehicles in 2016, so the level of service drops to C but still decent. By widening the ring road towards Situbondo according to standard (7 m), it can be an alternative for heavy vehicles which go to Situbondo.

**Keywords:** Adequacy evaluations, docks, parking, street

---

### I. Introduction

Geographically, Situbondo City Region is located directly adjacent to the east side of the ocean that is the Madura Strait, therefore the majority of the population domiciled and do their activity near the beach or coastal region in addition to the City of Situbondo.

Fishery Port City Beach is located in the district of Situbondo Banyu Putih which is approximately 50 km from the city center. Exact location of the fishery port in the district the Banyu Putih directly adjacent to Banyuwangi industrial plant which contained fish canning factory in the district Muncar.

In the development of this port functions not only as a fishery port but also as the place crossing to the Sepudi island which is included of Madura district. Different from the original plan, transportation within the port has changed. Reserved parking area no longer function optimally. The visitors who came to trade prefer to park their vehicle not far from where they were. So if they take place in or on the side of the breakwater pier, they park their vehicles there as well as the location because distance of the parking area and a desirable place is too far.

Fishery port in carrying out various activities should be equipped with the dock, which is consist of unloading dock, mooring docks, and dock supplies. These facilities must have to support each other so that it will launch all activities that occur in the fishery port.

Under the circumstances, there are several problems need attention and need to be further investigated, namely: to analyze the adequacy of the pier and parking lot, and to evaluate the adequacy of the road in the hinterland area.

### II. Research Methodology

Operational scheme of research conducted to assess the transportation management of fishing ports are presented in the following chart.

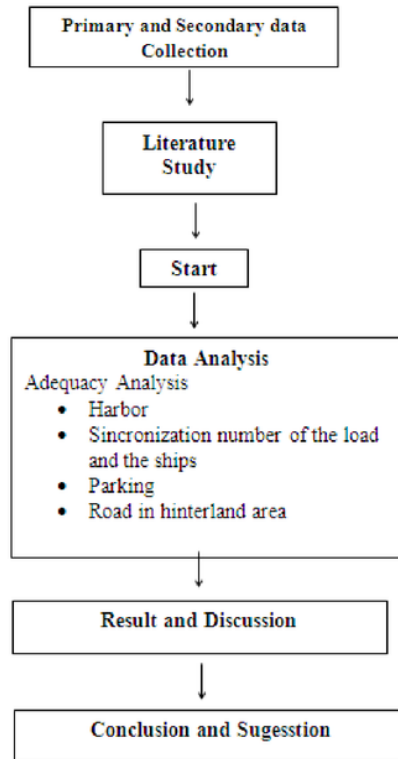


Figure 1. Framework of Operational Research

**Research Location**

The research was conducted in coastal fisheries the Port City of Situbondo and in the hinterland traffic, in this intersection a four-stroke without signal as sample.

**Secondary Data**

Secondary data include:

1. Ships trends data, obtained from Fishery Port Manager Unit of Mimbo Beach.
2. Vehicles trends data, obtained from the Central Statistics Agency of Situbondo City.

**Primary Data**

Primary data were obtained by direct observation include:

1. The number of vehicles in and out of the port data
2. Traffic volume at the intersection of four junction in hinterland area data

**Data Collection**

In addition to the secondary data obtained from the SitubondoFishery PortBeach Manager Unit, Situbondo Statistics Center, and the data from the department of marine and coastal fishing town of Situbondo, conducted a survey to obtain primary data on the number of vehicles in and out of the port and the characteristics of traffic in hinterland area. In the survey, there are several qualifications to the data collection process which can be seen in the following table.

Table 1. Qualification data collection process

Number	Qualifications	Exit-entry fishery port	Not signalized intersection of four
1	Surveyor which involved in the survey	Surveyor involved in the survey required is 4 people. Each observed a vehicle coming out of the harbor and the entrance to the harbor.	Surveyor required is 4 people. Each observing one segment intersection of four intersection.
2	Technical survey	Survey conducted by recording the type and number of vehicles that enter or exit	The survey was conducted by recording the type and number of passing vehicles

*Evaluation of Adequacy Fishery Port Infrastructure (Case Study on Fishery Port Mimbo Situbondo)*

		from the harbor.	in each segment of the intersection of four.
3	The timing of the survey	The survey was held on Sunday, June 16, 2013 at 06:00 to 8:00 pm and at 15:00 to 17:00 pm.	Surveys were conducted on Monday, June 17th, 2013 at 7:00 to 9:00 pm.
4	Working Equipment used	Surveyform, used to record the data of the survey include the type of vehicle, time and number of vehicles.	Survey form, is used to record the data of the survey include the type of vehicle, time and number of vehicles.

**Processing and Data Analysis**

From the collection of primary and secondary data then they were analyzed. All of this analysis is to determine some characteristics which must be fulfilled at this time and for a period of 5 (five) years later. The things to be analyzed is as follows.

- Number of Ships
- Number of vehicles in and out of the harbor
- Dock Infrastructure
- Parking Infrastructure
- Road Infrastructure in the Hinterland area

**III. Research Analysis Results And Discussion**


**Ship volume**

The volume of the ship which is the number of ships mooring every month for one year in 2012 either licensed or unlicensed presented in the following table.

**Table 2.** The volume of the port in 2012

NUMBER	MONTH	VOLUME (UNIT)	PERCENTAGE
1	January		8,03%
2	February	163	6,40%
3	March	180	7,08%
4	April	189	7,44%
5	May	191	7,51%
6	June	194	7,63%
7	July	203	7,99%
8	August	206	8,11%
9	September	228	8,95%
10	October	243	9,54%
11	November	253	9,94%
12	December	289	11,37%
	TOTAL	2542	100,00%


Source: Results of Analysis

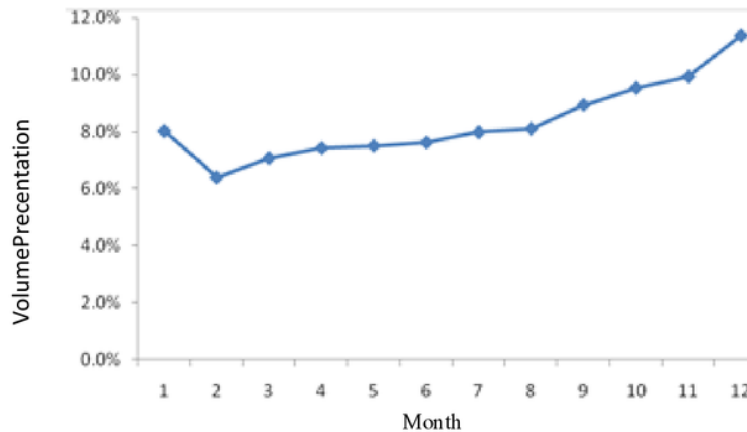

**Figure 2.** Graph the volume percentage of the vessel in 2012

Trends in the number of ships in the fishing port each year is different, because affected by fishing season. Based on the above chart, it can be seen that the volume of the vessel in 2012 was highest in December

that is 11.37% number of 289 ships of various sizes. The maximum of the next data to be sampled as the basis for calculating the adequacy of the pier. Here is a daily volume licensed ship in December 2012 based on the size of the vessel:

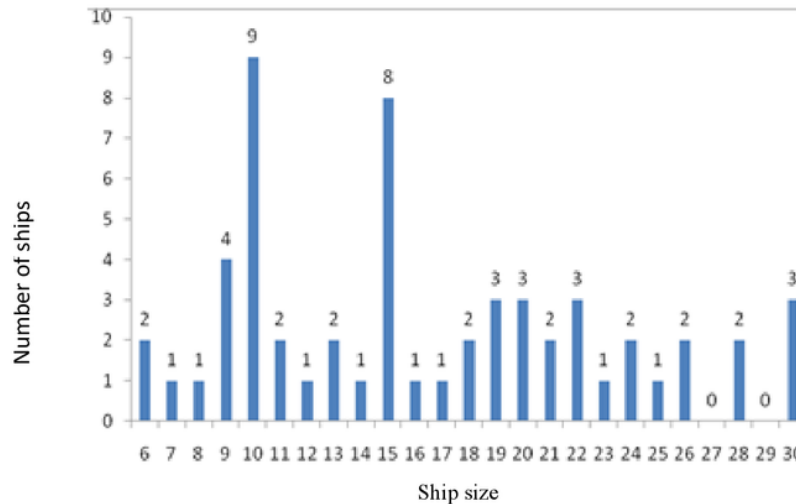

**Figure 3.** Graph the maximum number of mooring ships in 1 day

Based on the Minister of Marine and Fisheries Decree No. 165 In 2000, one of the criteria for Fishery Harbor Beach is the anchor mooring facilities for fishing boats with at least 10 GT.

From the data above, obtained maximum number of vessels in one day was 57 vessels, or 24.46% of the total number of ships for a month. For the size of the largest ships that dock is a 10 GT with the maximum number of ships mooring in one day was 9 ships or some 15.79%. While the vessel is less than 10 GT number 8 vessels or 14.04% and more than or equal to 10 GT number 49 ships or 85.96%.

**Adequacy of Dock**

Based on the Minister of Marine and Fisheries Decree No. 165 In 2000, the port has a quay length of coastal fisheries at least 100 meters and can accommodate at least 30 boats or 300 GT at one time.

Coastal fishing port Situbondo City has dock, that is landing dock / unloading and mooring docks which are differentiated according to the size of the ship. The effective length of each pier can be seen in the table below:

Long landing dock / unloading required for today can be seen from the following calculation:

- The landing dock / loading for vessel size > 30 GT
- loading and unloading time : 2 hours
- port operational time : 24 hours
- then the value  $\gamma$  : 12 hours
- size vessels 10 GT, LOA : 17.6 m
- number of vessels anchored : 100 ships

$$Ld = \frac{N}{\gamma} L + 0,15L$$

$$Ld = \frac{100}{12} 17,6 + 0,15(17,6): 168.67 \text{ m} \approx 168 \text{ m}$$

So the landing dock needed for today is 168m. It can be used for ± 3 vessels simultaneously with the space between the freedom of the ship is 0.15 L = 2,64m. From the above calculation it can be seen that the length of the pier that available is sufficient for current needs. The length of the pier is used along 168m of quay length of 200 m that provided.

From the analysis of the adequacy of the dock, then by changing the way the mooring of vessels dilated / transverse require less space so the ship mooring space requirements can be fulfilled until 2016. Transportation management at the dock that is needed is revamping the layout, repair ships queuing system.

**Adequacy of parking space**

**Analysis of Existing Parking Space**

The total effective area available parking area is 3402.88 m<sup>2</sup>. The area of 1458.38 m<sup>2</sup> of which is a parking area for cars and other 1944.5 m<sup>2</sup> is truck parking area. While the parking area for pick-ups, motorcycles, and unmotorized vehicles are not available.

In determining the need for parking space with the approach used accumulated the highest amount of accumulated parking. Based parking accumulation that occurred during the investigation in the field, the need for a parking space can be calculated by determining the number of vehicles at the time of maximum parking accumulation. The following is a calculation of existing parking space requirements:

- Motor: 284 x 1.5 : 426 m<sup>2</sup>
- Car : 34 x 12.5 : 425 m<sup>2</sup>
- Truck: 12 x 42.5 : 510 m<sup>2</sup>
- Unmotor : 57 x 1,5 : 85.5 m<sup>2</sup>
- Pickup : 60 x 15: 900 m<sup>2</sup>

From the above calculations for a car parking space requirement is 425 m<sup>2</sup> (29.14%) and a parking space for a truck that is 510 m<sup>2</sup> (26.23%). It can be seen that the parking spaces are available to provide for parking today.

**Parking Space Needs Analysis 5 Year Upcoming**

Predicted increase in the number of vehicles in 2012 – 2016 based on the secondary data obtained from the fisheries harbor Manager cottage Mimbo as follows:

- Motor : 4.78% per year
- Car : 5.02% per year
- Truck : 12.50% per year
- Pick-up : 12.50% per year

Calculations predicted number of vehicles parked in the accumulation of 2012 - 2016 can be seen in the following table:

**Table 3.** Parking accumulation data in 2007-2012

VEHICLE (unit)	YEAR					
	2007	2008	2009	2010	2011	2012
MOTOR	233	244	256	269	283	297
CAR	27	29	30	32	33	35
TRUCK	7	8	9	10	11	13
PICK-UP	34	39	45	51	58	67

**Table 4.** Predicted parking accumulation in 2011-2016

VEHICLE (unit)	YEAR					
	2011	2012	2013	2014	2015	2016
MOTOR	283	297	312	327	343	359
CAR	33	35	37	39	41	43
TRUCK	11	13	15	17	19	21
PICK-UP	58	67	76	86	96	108

Source: Results of Analysis

Based on the analysis of the parking accumulation predictions 2012 - 2016, the prediction of parking space requirements in 2016 can be calculated by the following calculation:

- Motor: 359 x 1,5 : 538.13 m<sup>2</sup>
- Car : 43 x 12.5 : 542.92 m<sup>2</sup>
- Truck: 22 x 42.5 : 919.04 m<sup>2</sup>
- Pickup : 108 x 12.5 : 1351.52 m<sup>2</sup>

From the above calculation, predicted the need for car parking spaces increased to 538.13 m<sup>2</sup> and for the truck is 919.04 m<sup>2</sup>. The increase in parking space requirements increased by 94.93%. While parking space for pick-up which was not originally provided, in 2016 the number increased to 108 units. This condition requires to provide parking space for pick-up as it may not be left parked in any place considering its function as a transporter of fish.

**Alternative of Parking Adequacy**

**1. Motor cycle**

The majority of visitors who use the port of the motor is intended for tours. Because of parking spaces for motorcycles is not provided, the riders parked their bikes around the fish auction place to their liking. By the

increasing number of motorcycles in 2016 will further aggravate the situation if a parking space for motor still not provided.

Breakwater is a destination for visitors who aim to travel. Seeing this situation, the best solution is to provide motorcycle parking spaces in the area of the breakwater. The following is the calculation of the adequacy of motorcycle parking spaces if bike parking spaces in the breakwater area is planned :


number of motor **7** : 359 engine  
 parking space unit of motor : 0.75 m x 2.00 m  
 breakwater width : 7.5 m  
 long breakwater (motorcycle parking area) : 172 m

If it is planned to use the parking pattern 2 sides, then the length of parking spaces required is:

$$\frac{359 \times 0,75 \text{ m}}{2} \leq 172 \text{ m} \times 2$$

$$269,25 \text{ m} \leq 344 \text{ m}$$

From the above calculation it can be seen that the parking spaces are provided to meet the needs of 688 m<sup>2</sup> park is 538.5 m<sup>2</sup>. Here is a plan drawing motorcycle parking spaces:

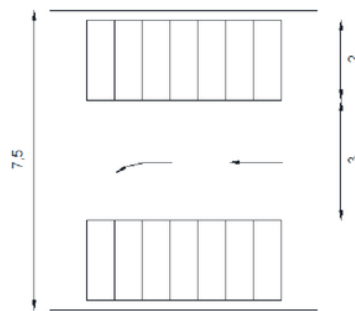

**Figure 4.** Parking a motor with a pattern of 2 sides

**2. Car**

Same with visitors using motors, majority of visitors who use the car also aims to tour and breakwater is their destination. So for a car parking space should also be provided in the area of the breakwater. The following is the calculation of the adequacy of car parking spaces if the planned car parking spaces in the breakwater area:


number of cars : 43 cars  
 parking space unit of car : 2.50 m x 5.00 m  
 breakwater width : 7.5 m  
 long breakwater (car park area) : 130 m

If it is planned to use the parking one side of the pattern, then the length of parking spaces required is:

$$43 \times 2,50 \text{ m} \leq 130 \text{ m}$$

$$108,58 \text{ m} \leq 130 \text{ m}$$

From the above calculation it can be seen that the car parking spaces are provided which can meet the needs of 650 m<sup>2</sup> parking is 542.9 m<sup>2</sup>. Here is a picture of car parking space plan:

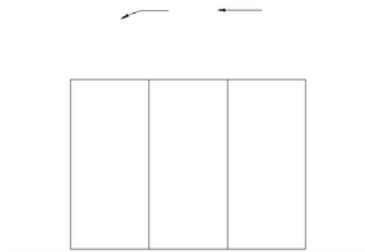

**Figure 5.** The car park to the pattern of one side

### 3. Truck and Pick Up

The purpose of the port visitors who use truck and pick up is for transporting fish and distributed to a particular place. Fish taken from public fisherman, must be pass through the fish auction first. However, for certain companies that have their own fishing boats, truck or pick-up can simply take the fish from the boat.

To overcome the problem of truck parking demand and a pick up in 2016, a truck and pick up parking space can be merged because their function is same. The parking spaces should not be far from the place of extraction of fish.

The parking spaces are required for the truck is 919.04 m<sup>2</sup> and for the pick up is 1351.52 m<sup>2</sup>. So, the total requirement is 2270.56 m<sup>2</sup>. The parking spaces that can be used is the area of the parking space of Fish Auction Place area as wide of 1944.5 m<sup>2</sup> and current car parking space area of 1458.38 m<sup>2</sup>. So, the total area of the parking area is 3402.88 m<sup>2</sup>.

From the analysis above, available parking spaces area 3402.88 m<sup>2</sup> can fulfill the parking needs of truck and pickup that is 2270.56 m<sup>2</sup>.

For a port visitor who use car and motorcycle aiming to shop, can be directly parked their vehicles in front of the parking area stalls selling that already available.

From the analysis of the adequacy of parking, then by using the tip of the breakwater area for motorcycle parking space (688 m<sup>2</sup>) with a pattern of two sides and the base of the breakwater area for car parking (650m<sup>2</sup>) with a pattern of one side and a parking area that has been available previously for the truck and pick-up, parking space requirements can be met. Transportation parking management required is revamping the layout of the parking of vehicles, repair queuing system, and policies related to the tariff.

### Adequacy Analysis on Regional Road Hinterland Road Geometric

The analyzes were performed at the intersection of four unsignal junction that closest to the port gate. This road has a width of ± 5 m for segment SumberAnyar Village direction, ± 10 m for the segment toward the port, ± 7 m for the segment towards the city and ± 10 m for the segment direction KarangTekok Village. This road is a two lane road and two-way.

### Traffic volume

Traffic volume obtained from the traffic results survey on the same day, which is Monday at 7:00 to 9:00 pm time is assumed to be stable enough to capture the data traffic flow, with a duration about 5 minutes. The survey was conducted in four segments, namely, the direction of the SumberAnyar Village, direction of the harbor, direction of the city, and the direction of the Village of KarangTekok. From the results of this survey obtained the magnitude of the flow of traffic on each segment. So it can be known volume of vehicles involved in each road segment. Here are the results of the vehicular traffic volume calculation :

**Table 5. Volume LV (pcu / h)**

Origin	Destination			
	Fishery Port	The City	SumberAnyar Village	KarangTekok Village
Fishery Port	0	19	5	1
The City	10	0	19	1
SumberAnyar Village	6	16	0	0
KarangTekok Village	1	2	0	0

Source: Results of Analysis

**Table 6. Volume HV (pcu / h)**

Origin	Destination			
	Fishery Port	The City	SumberAnyar Village	KarangTekok Village
Fishery Port	0,0	24,8	1,5	0,0
The City	17,3	0,0	10,5	2,3
SumberAnyar Village	0,0	9,0	0,0	0,8
KarangTekok Village	0,8	1,5	0,0	0,0

Source: Results of Analysis

**Table 7. Volume MC (pcu / h)**

Origin	Destination			
	Fishery Port	The City	SumberAnyar Village	KarangTekok Village
Fishery Port	0,0	44,5	74,5	11,3
The City	48,5	0,0	114,3	17,3
SumberAnyar Village	74,5	78,5	0,0	3,5
KarangTekok Village	9,3	8,0	5,8	0,0

Source: Results of Analysis



From the above data, it can be seen  $Q_{TOT}$  namely:

$$Q_{TOT} = Q_{LV} + Q_{HV} + Q_{MC}$$

$$Q_{TOT} = 80 + 68.5 + 490$$

$$Q_{TOT} = 638.5 \text{ pcu / hour}$$

**Capacity and Degree of Saturation**

In determining capacity, necessary steps in accordance with MKJI calculations. Here are the steps in determining the capacity :

1) The value of the base capacity ( $C_0$ )

This intersection has four arms, each of which has 2 row and 2 lanes. Therefore, according to MKJI 97, this intersections are type 422, so it has  $C_0$  value 2900 pcu / hour.

4) Approach width adjustment factor ( $F_w$ )

$$F_w = 0.70 + 0.0866 (W_i)$$

$$F_w = 0.70 + 0.0866 (4)$$

$$F_w = 1.046$$

3) The adjustment factor is the main street median ( $F_M$ )

Because there are no medians on main roads, then the value of  $F_M$  is 1.00.

4) The adjustmentsize of the city factor ( $F_{CS}$ )

Situbondo is a very small town with a population <0.1 million, then the  $F_{CS}$  value was 0.82.

5) The adjustment type of side barrier road environment and non-motorized vehicles factor

Type of RE road environment class = commercial  
Side barriers SF class = low

The ratio of non-motorized vehicles  $P_{UM}$  = 1.0

So,  $F_{RSU}$  = 0.86

4) Turn left adjustment factor ( $F_{LT}$ )

$$F_{LT} = 0.84 + 1.61 (P_{LT})$$

$$F_{LT} = 0.84 + 1.61 (0.25) = 1.24$$

7) Turn Right adjustment factor ( $F_{RT}$ )

Due to the intersection with four arms, then the value of the  $F_{RT}$  is 1.0.

8) Minor road flow adjustment factor ( $F_{MI}$ )

$$F_{MI} = 1.19 \times PMI2 - PMI + 1.19 \times 1.19$$

$$F_{MI} = 1.19 \times 0.52 \text{ to } 1.19 \times 0.5 + 1.19$$

$$F_{MI} = 0.297 \text{ to } 0.595 + 1.19$$

$$F_{MI} = 0.892$$

3) From the data above, the capacity can be calculated as follows:

$$C = C_0 \times F_w \times F_M \times F_{CS} \times F_{RSU} \times F_{LT} \times F_{RT} \times F_{MI}$$

$$C = 2900 \times 1.046 \times 1.00 \times 0.82 \times 0.86 \times 1.24 \times 1.0 \times 0.892$$

$$C = 2366.075 \text{ pcu / hour}$$

So the degree of saturation (DS) is:

$$DS = Q_{TOT} / C$$

$$DS = 635 / 2366.075$$

$$DS = 0.29$$

From the analysis above obtained value of DS was 0.29, which means that the intersection of four levels of service B, namely:

1. Flow is stable with moderate traffic volume and speed began to be restricted by traffic conditions.
2. The traffic density low and internal resistance not affect the speed of traffic.
3. The driver still has enough freedom to choose the speed and lane to use.

**Hinterland Regional Traffic Analysis 5 Year Upcoming**

**• Predicted increase in the number of vehicles in 2016**

Based on data from the Central Statistics Agency Situbondo City, obtained number of vehicles in 2007 - 2010 are as follows:

**Table 8.** The volume of vehicles in Situbondo in 2007-2010 (units)

Vehicles	2007	2008	2009	2010
MC	43791	53149	61864	64253
LV	4123	5004	5825	6050
HV	3759	4562	5310	5515

Source: Results of Analysis

From the above data, to predict the increase in the number of vehicles in 2016 can use a Line Linear Equations.

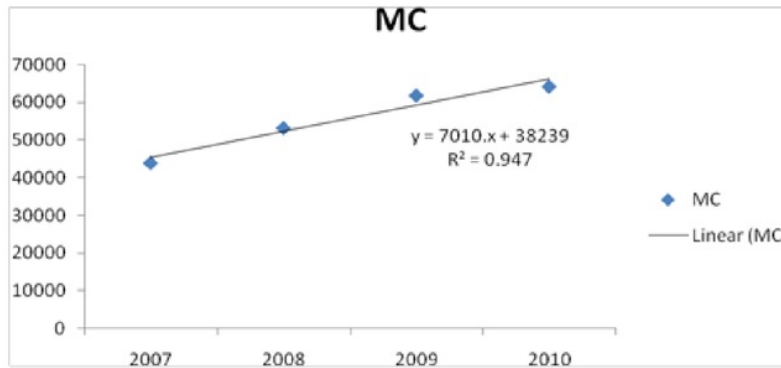


Figure 6. Graph linear equations MC in 2007-2010

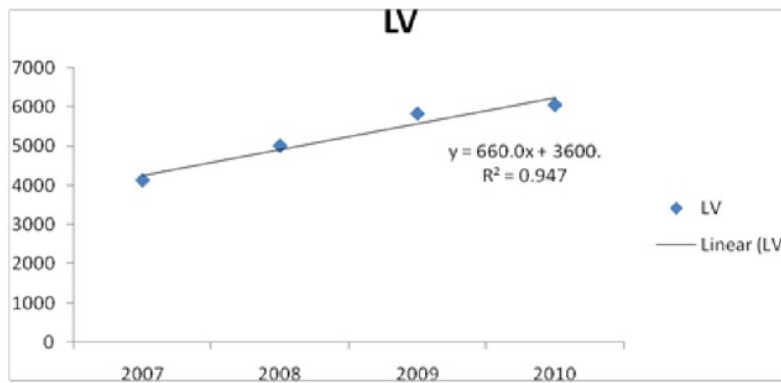


Figure 7. Graph linear equations LV in 2007-2010

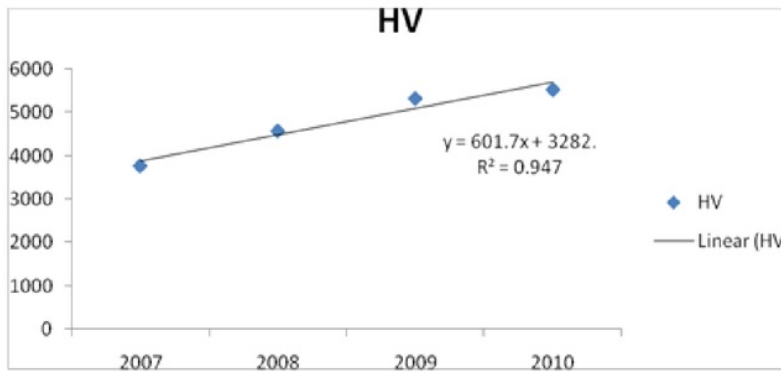


Figure 8. Graph linear equations HV years 2007-2010

From the above linear equation, can be seen the number of vehicles in the year 2011 - 2016 are as follows:

**Table 9.** Prediction of volume of vehicles in Situbondo 2016 (units)

Vehicles	2011	2012	2013	2014	2015	2016
MC	73289	80299	87309	94319	101329	108339
LV	6900	7560	8220	8880	9540	10200
HV	6291	6892	7494	8096	8697	9299

Source: Results of Analysis

From the analysis above it can be seen that the increase in the number of vehicles in Situbondo from year to year, an average of 9.12%. So, the prediction of the number of vehicles per hour in the hinterland in 2016 are as follows:

**Table 10.** Volume LV 2016 (pcu / h)

Origin	Destination			
	Fishery Port	The City	SumberAnyar Village	KarangTekok Village
Fishery Port	0	29	7	2
The City	15	0	29	2
SumberAnyar Village	9	24	0	0
KarangTekok Village	2	2	0	0

Source :Analisis Results

**Table 11.** Volume of HV 2016 (pcu / h)

Origin	Destination			
	Fishery Port	The City	SumberAnyar Village	KarangTekok Village
Fishery Port	0,0	38,3	2,3	0,0
The City	26,7	0,0	16,2	3,5
SumberAnyar Village	0,0	13,9	0,0	1,2
KarangTekok Village	1,2	2,3	0,0	0,0

Source: Results of Analysis

**Table 12.** Volume MC 2016 (pcu / h)

Origin	Destination			
	Fishery Port	The City	SumberAnyar Village	KarangTekok Village
Fishery Port	0,0	68,8	115,3	17,4
The City	75,0	0,0	176,8	26,7
SumberAnyar Village	115,3	121,4	0,0	5,4
KarangTekok Village	14,3	12,4	8,9	0,0

Source: Results of Analysis

From the above data, it can be seen  $Q_{TOT}$  for 2016. They are:

$$\begin{aligned}
 Q_{TOT} &= Q_{LV} + Q_{HV} + Q_{MC} \\
 Q_{TOT} &= 119 + 106 + 758 \\
 Q_{TOT} &= 982 \text{ pcu / hr}
 \end{aligned}$$

#### Degree of Saturation (DS)

The degree of saturation (DS) in 2016 are as follows:

$$\begin{aligned}
 DS &= Q_{TOT} / C \\
 DS &= 982 / 2366.075 \\
 DS &= 0.42
 \end{aligned}$$

From the analysis above DS value obtained was 0.42, which means that the intersection of four had a level of service C, namely :

1. Flow is stable but the speed and movement of vehicles controlled by the higher traffic volume.
2. The traffic density was moderate due to the traffic internal resistance increased.
3. The driver has a limitation to select speed, change lanes or precede.

#### Alternative Traffic Hinterland

From the analysis of the above study concluded that traffic conditions hinterland today to five years is still feasible. Associated with urban traffic regulations that HV vehicles may not cross the city need an alternative to the HV traffic flow towards Situbondo.

There is a road leading Situbondo port right next to the gate that was originally supplied to the HV vehicles will be out from Situbondo towards Banyuwangi. However, it doesn't work because the width road is

less than the standard that is 5 m. In order to its function, the way need to be widened. This method is possible because in the right and left of the road there are road shoulder width respectively  $\pm 1.5 - 2$  m.

#### **IV. Conclusions And Recommendations**

##### **Conclusion**

Based on the results of research and analysis of data, it can be concluded as follows:

1. Dock Adequacy
  - a) Needs of existing docks unloading and mooring for boats less size and more than 10T still be fulfilled properly.
  - b) Unloading dock for ship size is less or more than 10 GT still be met but overload jetty mooring for vessels up to 254% the size of more than 10 GT and 128% for vessels less than 10 GT size.
  - c) By changing the way the mooring of vessels dilated / transverse require less space so the ship mooring space requirements can be fulfilled until 2016.
2. Parking Space Adequacy
  - a) Existing parking spaces are only available for cars and trucks only and enough for parking needs.
  - b) The number of vehicles entering the port increased, so that parking spaces be overloaded, so it is needs to provide parking spaces for motorcycles and pick-up.
  - c) By utilizing tip of the breakwater area for motorcycle parking space (688 m<sup>2</sup>) with a pattern of two sides and the base of the breakwater area for car parking (650m<sup>2</sup>) with a pattern of one side and a parking area that has been available previously for the truck and pick-up, parking space requirements can be met.
3. Adequacy Road at Hinterland Region
  - a) Review existing traffic volume area (intersection of four non signal) can meet and have a level of service B but for HV vehicles heading towards Situbondo must pass through the city because the roads are too narrow and can not meet the needs.
  - b) With the increasing number of vehicles in 2016, the level of service drops to C but still decent.
  - c) By widening the ring road towards Situbondo according to standard (7 m), it can be an alternative to the HV vehicle towards Situbondo.

##### **Recommendations**

In accordance with the secondary data, field observations, and processed data, then we give some suggestions which is also an alternative solution of the above problems:

1. Alternatives to address the needs of ship mooring space in 2016 is to change the way aft mooring of vessels become dilated.
2. To meet the needs of car parking spaces in the port 2016 can capitalize on the breakwater area for motorcycles and cars as well as parking spaces that have been there before can be used for truck and pick-up.
3. In accordance with the rules of urban traffic that HV vehicles are prohibited from passing on city streets, then to widen the ring road towards Situbondo who has been there can be a solution.

##### **References**

- [1]. Morlok, Edward K. Pengantar Teknik dan Perencanaan Transportasi. Erlangga. Jakarta. 1988.
- [2]. Nasution, H.M.N.MS.Tr. Manajemen Transportasi Ghalia Indonesia. Jakarta. Juni 1996.
- [3]. Ofyar Z. Tamin, 2000, Perencanaan dan Permodelan Transportasi, Penerbit ITB, Bandung.
- [4]. Triatmodjo, Bambang. Pelabuhan. Beta Offset. Yogyakarta. Februari 1996.
- [5]. Widyahartono, Bob. Manajemen Transportasi. Depdikbud Universitas Terbuka. Jakarta. 1986.
- [6]. -----, 1996 Pedoman Teknis Penyelenggaraan Fasilitas Parkir. Jakarta: Direktorat Jenderal Perhubungan Darat, Departemen Perhubungan.

# Evaluation of Adequacy Fishery Port Infrastructure (Case Study on Fishery Port Mimbo Situbondo)

---

## ORIGINALITY REPORT

---

3%

SIMILARITY INDEX

2%

INTERNET SOURCES

1%

PUBLICATIONS

2%

STUDENT PAPERS

---

## PRIMARY SOURCES

---

1	Submitted to Indian Institute of Technology, Kanpur Student Paper	1%
2	iosrjournals.org Internet Source	1%
3	Submitted to Sultan Agung Islamic University Student Paper	1%
4	eprints.uns.ac.id Internet Source	<1%
5	Submitted to Universitas Semarang Student Paper	<1%
6	digilib.unmuhjember.ac.id Internet Source	<1%
7	media.neliti.com Internet Source	<1%

---

Exclude quotes On

Exclude bibliography On

Exclude matches Off